

CONSUMER INFORMATION

VEHICLE STOPPING DISTANCE

This table indicates braking performance that can be met or exceeded by the vehicles to which it applies, without locking the wheels under different conditions of loading.

The information presented represents results obtained by skilled drivers under controlled road and vehicle conditions, and the information may not be correct under other conditions.


Description of vehicles to which this table applies. **HONDA CB750 CUSTOM**

Full Operational Service Brake

Load

Light

Maximum

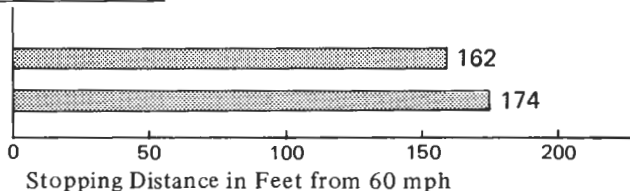

SPECIFICATIONS

Item	
DIMENSIONS Overall length Overall width Overall height Wheel base	2,300 mm (90.6 in) 920 mm (36.2 in) 1,165 mm (45.9 in) 1,535 mm (60.4 in)
WEIGHT Dry weight	234 kg (516 lbs)
CAPACITIES Engine oil Fuel tank Fuel reserve tank Passenger capacity Vehicle capacity load	3.5 ℓ (3.7 US qt) After draining 16.5 ℓ (4.4 US gal) 2.8 ℓ (0.7 US gal) Operator and one passenger 217 kg (480 lbs)
ENGINE Bore and stroke Compression ratio Displacement	62.0 x 62.0 mm (2.44 x 2.44 in) 9.0 : 1 749 cc (45.7 cu. in)

Item							
Spark plug <table border="1" data-bbox="348 221 1033 436"> <tr> <td data-bbox="348 221 689 291">Standard</td> <td data-bbox="689 221 1033 291">DR8ES-L (NGK) X24ESR-U (ND)</td> </tr> <tr> <td data-bbox="348 291 689 363">For cold climate (Below 5°C, 41°F)</td> <td data-bbox="689 291 1033 363">DR7ES (NGK) X22ESR-U (ND)</td> </tr> <tr> <td data-bbox="348 363 689 436">For extended high speed riding</td> <td data-bbox="689 363 1033 436">DR8ES (NGK) X27ESR-U (ND)</td> </tr> </table> Spark plug gap Valve clearance Intake, Exhaust Idle speed	Standard	DR8ES-L (NGK) X24ESR-U (ND)	For cold climate (Below 5°C, 41°F)	DR7ES (NGK) X22ESR-U (ND)	For extended high speed riding	DR8ES (NGK) X27ESR-U (ND)	 0.6–0.7 mm (0.024–0.028 in) 0.06–0.13 mm (0.002–0.005 in) 1,000 ± 100 rpm
Standard	DR8ES-L (NGK) X24ESR-U (ND)						
For cold climate (Below 5°C, 41°F)	DR7ES (NGK) X22ESR-U (ND)						
For extended high speed riding	DR8ES (NGK) X27ESR-U (ND)						
CHASSIS AND SUSPENSION Caster Trail Tire size, front Tire size, rear	 60°30' 125 mm (4.9 in) 110/90-19 62H 130/90-16 67H						

Item	
<p>POWER TRANSMISSION</p> <p>Primary reduction</p> <p>Final reduction</p> <p>Gear ratio, 1st</p> <p> 2nd</p> <p> 3rd</p> <p> 4th</p> <p> 5th</p>	<p>2.381</p> <p>2.389</p> <p>2.533</p> <p>1.789</p> <p>1.391</p> <p>1.160</p> <p>0.964</p>
<p>ELECTRICAL</p> <p>Battery</p> <p>Generator</p> <p>Firing order</p> <p>Fuse</p>	<p>12V-14AH</p> <p>Three Phase A.C. 12V-0.26 kW</p> <p>at 5,000 rpm</p> <p>1-2-4-3</p> <p>30A (Main), 15A</p>

Item	
LIGHTS Headlight Tail/stoplight Turn signal light/running light Turn signal light Meter lights	H4 BULB (Philips 12342/99, or equivalent) 12V-3 CP/32 CP SAE No. 1157 FRONT: 12V-32 CP/3 CP SAE No. 1034 REAR: 12V-32 CP SAE No. 1073 12V-2 CP SAE NO.: No. 57

NEW REAR TIRE 72,000 MAY '93
 NEW 530 O-RING CHAIN 73,200 JULY '93

OWNER SATISFACTION

Your satisfaction and goodwill are important to your dealer and to us. Normally, any problems with the operation of your vehicle will be handled by your dealer's Service Department. Sometimes, however, despite the best intentions of all concerned, misunderstandings can occur. If your problem has not been handled to your satisfaction, we suggest you take the following action:

- * Discuss your problem with a member of dealership management. Often complaints can be quickly resolved at that level. If the problem has already been reviewed with the Service Manager, contact the owner of the dealership or the General Manager.
- * If your problem still has not been resolved to your satisfaction, contact the Motorcycle Customer Service Department, AMERICAN HONDA MOTOR CO., INC. 100 West Alondra Boulevard, Gardena, California 90247 (213) 327-8280, and provide them with:
 - Your name, address and telephone number
 - Vehicle frame number
 - Dealer's name and location
 - Vehicle delivery date and present mileage
 - Nature of problem

After reviewing all the facts involved, you will be advised of what action can be taken.

Please bear in mind that your problem will likely be resolved in the dealership, using the dealer's facilities, equipment and personnel. So it is very important that your initial contact be with the dealer.

Your purchase of a Honda product is greatly appreciated by both your dealer and American Honda Motor Co., Inc. We want to assist you in every way possible to assure your complete satisfaction with your purchase.



HONDA MOTOR CO., LTD.

31MA500

英SM A 15008105C

PRINTED IN JAPAN